ROTARY TRANSDUCER



Content:

Technical Data	••••
Electrical Data	3
Technical Drawing	4
Options	
Electrical Connection	
Accessories	6
Order Code	••••

Series WP

Key-Features:

- Housing diameter 40 mm (WP-M) or 60 mm (WP)
- Shaft diameter 6 mm (WP-M) or 10 mm (WP)
- Measurement ranges from 90° to 43200 °C
- Linearity up to 0.05 %
- Analog output: Potentiometer, 0...10 V, 4...20 mA
- Teachable outputs: 0...5 V, 0...10 V, with an additional Open-Collector switching output
- Temperature range: -20...+85 °C (optional -40...+85 °C or -20...+120 °C)
- Rotational speed max. 200 r/min
- Housing: Aluminium anodised, stainless steel



TECHNICAL DATA

		W	/P-M		WP	
Housing diameter	[mm]		40		60	
Shaft diameter	[mm]		6		10	
Mounting		centering c	ollar Ø 20 mm		clamping flange Ø	36 mm
Measurement range	[°]	90 to 3600 (s	ee table below)		90 to 43200 (see tabl	e below)
Linearity	[%]		0.3 to 0.0	05 (see table b	elow)	
Output signal		1 k	Ω, 420 mA, 010 V, 0	5 V (see <u>"Elec</u>	trical Data" auf Seite 3)	
Signal direction (view on shaft)		signal increasing counter clock wise				
Rotation speed max.	[r/min]	200				
Torque	[Nm]	0.008				
Shaft bearing		2 sealed bearing, type 2RS				
Shaft Load		radial: 40	N axial: 25 N		radial: 50 N axial	: 30 N
Protection class			housing: IP67 sha	ft: IP60 (optio	nal: IP64 or IP67)	
Operating temperature	[°C]		-20+85 (option	nal: -40+85 o	r -20+120 1)	
Storage temperature	[°C]			-30+85		
Life cycle			> !	5 Million turns		
Connection			connector outpu	ut M12 or cabl	e output (TPE)	
Housing material		Aluminium, titanium grey anodised; stainless steel				
Shaft material			S	tainless steel		
Weight	[g]	app	rox. 130		approx. 260	
	WD M OO	WD M 100	WD M 220	WD M ST	WD M ET	WD M 10T

		WP-M-90	WP-M-180	WP-M-320	WP-M-3T	WP-M-5T	WP-M-10T
Measurement range	[°]	90	180	320	1000	1800	3600
Linearity	[%]		0.3			0.15	
Improved Linearity (optional)	[%]		0.2			1	0.1 / 0.05
Potentiometer Type			1 turn			5 turn	10 turn
Continuous rotation possible 2)		yes				no	

		WP-90	WP-180	WP-320	WP-3T	WP-5T	WP-10T	WP-15T	WP-20T	WP-25T	WP-30T
Measurement range	[°]	90	180	320	1000	1800	3600	5400	7200	9000	10800
Linearity	[%]		0.3		0.	15			0.1		
Improved Linearity (optional)	[%]		0.2		0	.1			0.05		
Potentiometer Type			1 turn		3 turn	5 turn	10 turn	10 turn ³⁾			
Continuous rotation possible 2)		yes			no						

		WP-40T	WP-45T	WP-50T	WP-60T	WP-70T	WP-75T	WP-80T	WP-90T	WP-100T	WP-120T
Measurement range	[°]	14400	16200	18000	21600	25200	27000	28800	32400	36000	43200
Linearity	[%]		0.1								
Improved Linearity (optional)	[%]		0.05								
Potentiometer Type						10 tu	urn 3)				
Continuous rotation possible 2)						n	О				
1) Option -20+120 °C not for sensors with 1 turn potentiometer, 420 mA, 010 V or 05 V 2) see <u>"Potentiometer Notes" auf Seite 3</u> 3) with gearing											

ELECTRICAL DATA

	Potentiometer 1 kΩ	Voltage 010 V	Current 420 mA	Voltage 05 V, 010 V (teachable)	
Output	1 kΩ	05 V, 010 V, galvanically isolated, 4 conductors	420 mA, 2 conductors	05 V, 010 V, 3 conductors	
Power supply	max. 30 V	123	0 VDC	835 VDC	
Recommended cursor current	< 1 μΑ		-		
Current consumption max.	-	22.5 mA (unloaded)		-	
Power consumption max.	-	-	-	150 mW	
Output current	-	max. 10 mA, min. load 10 k Ω	max. 50 mA in case of error	max. 10 mA, min. load 1 k Ω	
Dynamics	-	< 3 ms from 0100 % and 1000 %	< 1 ms from 0100 % and 1000 %	1 ms	
Resolution	theor	retically unlimited, limited by the	noise	1 mV	
Noise	dependent on the quality of the power supply	0.5 mV _{eff}	1.6 μA _{eff}	2 mV _{eff}	
Inverse-polarity protection	-		yes		
Short-circuit proof	-	yes	-	yes	
Working temperature	-20+85 °C / optional: -40+85 °C or -20+120 °C		5		
Temperature coefficient	±0.0025 %/K	0.0037 %/K	0.0079 %/K	0.0016 %/K	
EMC	-		according to EN 61326-1:2013		
Circuit	Cursor +V V +V +V	Signal GND _{Signal} +V GND V +V +V	+V Signal A +V +V +V	Signal MFL +V GND V +V H MFL = multi-functional line for the use of the Squeezer	


POTENTIOMETER NOTES

Rotary transducers with 1 turn potentiometer

This type of potentiometer is used to measure angles smaller than 360°. The sliding track has a circular shape. A certain segment of the sliding track is non-conducting. This way the beginning and the end of the measurement range is defined. With view on shaft the signal increases when the shaft is turned counter-clockwise. The output signal drops to zero as soon as the cursor reaches the non-conducting part of the sliding track. If turned further, the signal starts to increase again as soon as the beginning of the measurement range is reached. A continuous rotation is possible.

Generally spoken the 1 turn potentiometer is made for use within the measurement range. If the sensor is used in a continuous rotation mode, the cursor gets dragged over the non-conducting segment of the sliding track which leads to an increased wear.

Schematic diagram of the sliding track (view on shaft)



Rotary transducers with 3, 5 or 10 turn potentiometers

This type of potentiometer has a start and an end stop (no continuous rotation). With view on shaft the signal increases when the shaft is turned counter-clockwise.


Installation of the sensor

Before installing the rotary transducer, it is very important to manually turn the shaft clockwise (view on the shaft) until the initial stop is reached and then a few degrees back again. After this procedure, the sensor can be installed (without turning the shaft).

This is the only way to make sure that the beginning of the measurement range corresponds with the start of the sliding track and an overwinding at the end of the measurement range is avoided.



TECHNICAL DRAWING

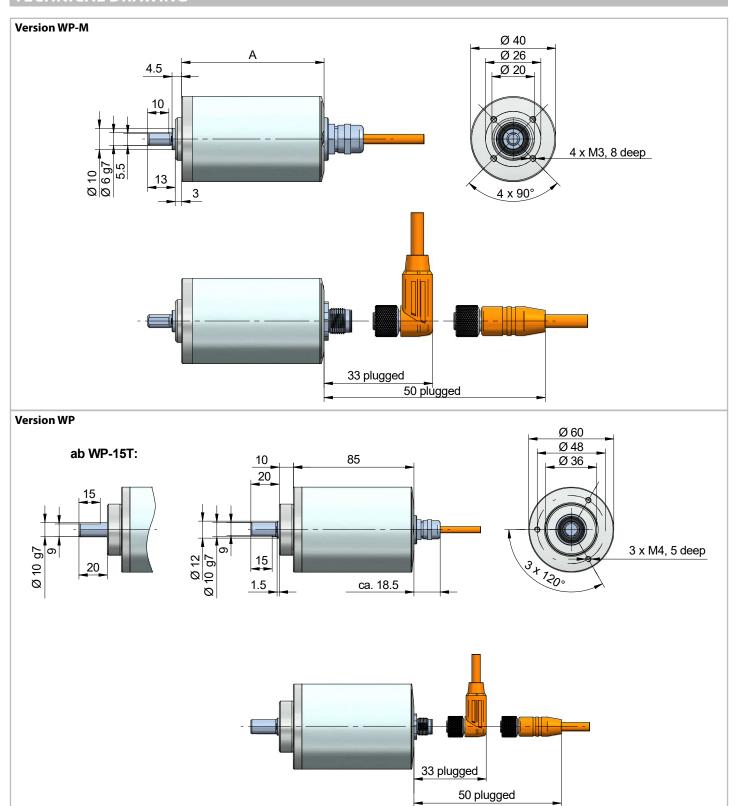

OPTIONS

The following table gives an overview of frequently used options, with which the standard sensors can be equipped. Please pay attention that not all options can be combined. Information on possible combinations can be found in the order codes.

Option	Order code	Descript	ion
Improved linearity	WP-L20, WP-L10, WP-L05	Improved linearity 0.2 % (WP-L20), 0.1 % (WP-L10) or	0.05 % (WP-L05)
Inverted output signal	WP-IN	The analog signal of the sensor is increasing by extracting the rope (standard). Option IN inverts the signal, i.e. the signal of the sensor declines by extracting the rope.	inverted inverted inverte
Protection class IP64	WP-IP64	Please use this option in case the sensor is used in a h	numid environment.
Protection class IP67	WP-IP67	Please use this option in case the sensor (temporarily) immersed in water.
Corrosion protection HARTCOAT®	WP-CP	All external anodised aluminium parts of sensor are canodic oxidation that protects the sensor from corrost hard ceramics-like layer.	3
Increased temperature range high	WP-H120	Devices with potentiometer output and cable output range -20+120 °C. (Potentiometer output 1R with ca	
Increased temperature range low	WP-T40	The use of special components and grease enable -40+85 °C.	s the sensor to work at a temperature range


ELECTRICAL CONNECTION

Cable output, 4 poles

Cable colour	1 kΩ	010 V	420 mA 05 V, 010 V (teachable)		Cable specification	s
Ca.D. C CO.O U.					Cable type	TPE, flexible
BN	+V	+V	+V	+V	Diameter	Ø4.5 mm
WH	Cursor	Signal	n. c.	Signal	Wire	0.25 mm ²
BU	GND	GND _{supply}	Signal	GND	Temperature	fixed installation: -30+85 °C,
ВК	n. c.	GND _{signal}	n. c.	MFL 1)	remperature	flexible installation: -20+85 °C
1) Multi-functiona	l line					

M12-Steckerausgang (Stifteinsatz), 4-polig

Pin	1 kΩ	010 V	420 mA	05 V, 010 V (teachable)	Connection cable K4P Cable colour
1	+V	+V	+V	+V	BN
2	Cursor	Signal	n. c.	Signal	WH
3	GND	GND _{supply}	Signal	GND	BU
4	n. c.	GND _{signal}	n. c.	MFL 1)	BK
1) Multi-functio	onal line	•			

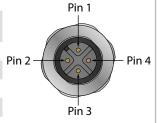



ACCESSORY SQUEEZER FOR TEACHABLE OUTPUTS


Rotary sensors with the analogue output versions 5VT and 10VT are equipped with teachable, internal electronics, called VT-Electronics. The signals provided by the sensor's potentiometer are digitized by the VT-Electronics. This digital information is first processed by the electronics, then transformed back and given out as an analogue output signal 0 to 5 V or 0 to 10 V.

The digitization offers two possibilities of adjustment, by which the sensor can be configured individually using the Squeezer:

- 1. Teaching of the measurement range. After a successful teaching process, the squeezer can be pulled off the sensor and be replaced by a standard cable or connector.
- 2. Setting an individual switching point. The squeezer allows the setting of an individual switching point open collector. The switching signal is emitted through the multi-functional line (MFL).




A detailed description of the functions can be found in a separate manual.

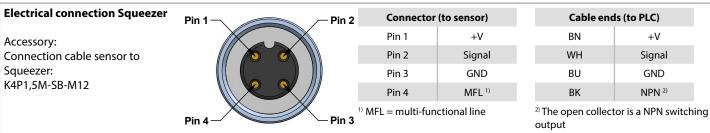


ACCESSORIES COUPLINGS

Metal bellow couplings are used for the backlash-free connection of encoders and drive shafts (e.g. motor shafts). The couplings work wear-free and compensate for axial, radial and angular misalignment. Mounting on the shafts is effected by means of frictional locking using clamping hubs.

The following couplings are available as standard accessories:

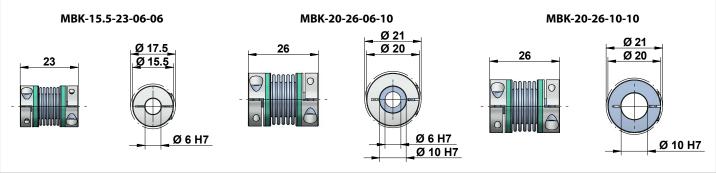

ORDER CODE

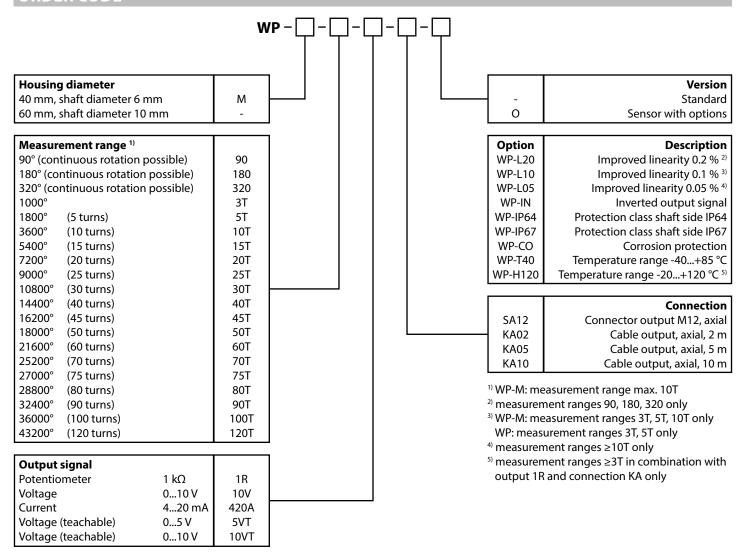

ACCESSORIES

Teach accessories for teachable outputs 5VT and 10VT					
SQUEEZER2M	2 m cable				
SQUEEZER5M	5 m cable				
SQUEEZER10M	10 m cable				
Cable with mating	connector M12 (female), 4 poles, shielded				
K4P2M-S-M12	2 m, straight connector				
K4P5M-S-M12	5 m, straight connector				
K4P10M-S-M12	10 m, straight connector				
K4P2M-SW-M12	2 m, angular connector				
K4P5M-SW-M12	5 m, angular connector				
K4P10M-SW-M12	10 m, angular connector				
Digital displays for sensors with analog output, 2 channel					

For more information and options please refer to the WAY-AX data sheet.

touch screen, supply: 18...30 VDC

touch screen, supply: 115...230 VAC

Couplings	
MBK-15.5-23-06-06	Metal bellow coupling, 2 x Ø 6 mm
MBK-20-26-06-10	Metal bellow coupling, Ø 6 mm, Ø 10 mm
MBK-20-26-10-10	Metal bellow coupling, 2 x Ø 10 mm

Mating connector M12 (female), 4 poles, shielded					
D4-G-M12-S	straight, M12 for self assembly				
D4-W-M12-S	angular, M12 for self assembly				

Connection cable sensor to Squeezer			
K4P1,5M-SB-M12	1.5 m, 4-pole, shielded		

Subject to change without prior notice.

WayCon Positionsmesstechnik GmbH

email: info@waycon.de internet: www.waycon.biz

WAY-AX-S

WAY-AX-S-AC



Head OfficeMehlbeerenstr. 4
82024 Taufkirchen

Tel. +49 (0)89 67 97 13-0 Fax +49 (0)89 67 97 13-250 **Office Köln** Auf der Pehle 1 50321 Brühl

Tel. +49 (0)2232 56 79 44 Fax +49 (0)2232 56 79 45